	ITTC – Recommended Procedures	7.6-02-04 Page 1 of 12	
	Sample Work Instructions Calibration of Micrometers	Effective Date 2002	Revision 00

CONTENTS

PURPOSE

WORK INSTRUCTION

1. Introduction

2. Subject and Condition of Calibration

- 2.1 Subject and Main Tools of Calibration
- 2.2 Calibration Conditions

3. Technical Requirements and Calibration Method

- 3.1 Exterior
- 3.2 Relationship Among Parts
- 3.3 Axial Slide Movement and Radial Sway of Micrometer Bolt
- 3.4 Relative Deviation Between Gauge Button and Working Plane of Micrometer Bolt
- 3.5 Measuring Force
- 3.6 Width and Width Difference of Lines

3.7 Relative Position of Indicator Needle and Dial

3.8 Distance Between End Face Edge of Conical Surface For Differential Tube and Engraved Surface of Fixed Sleeve

3.9 Relative Position Between Conical Surface End Face of Differential Tube and Millimeter Line of Fixed Sleeve

3.10 Surface Roughness of Working Plane

3.11 Accuracy of Working Plane

3.12 . Parallelism of Two Working Planes

3.13 Error of Indication

3.14 Measuring Rod for Checking

4. Treatment of Calibration Result and Calibration Period

4.1 Treatment of Calibration Results

4.2 Calibration Period

Source:

Verification regulation of micrometer

[Issued on Aug. 25, 1995 and put into effect since Feb. 1, 1996 by National Technical Bureau - JYG 21—95, National Measuring Verification Regulation of People's Republic of China]

Prepared by	Approved
Quality Systems Group of 23 rd ITTC	23 rd ITTC 2002
Date	Date

Calibration of Micrometers

PURPOSE

This working instruction can be applied to the verification of micrometers for measuring outer diameter with the measuring range up to 500 mm and to micrometers for measuring plate or wall thickness with a measuring range up to 25 mm. It applies to new products with a scale division value of 0.01 mm, as well as those in service and after repair.

WORK INSTRUCTION

1. Introduction

The micrometer consists of a frame, a gauge button, a micrometer bolt, a force measuring device and a locking device, shown in Figures 1, 2, 3, 4, 5, 6 and 7 respectively.

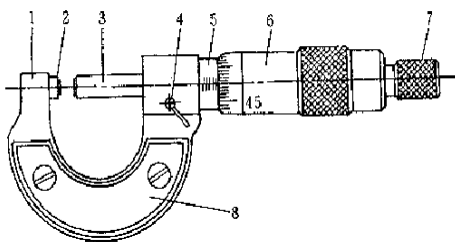


Figure 1 Micrometer with fixed gauge button
Where, 1 frame, 2 gauge button, 3 micrometer bolt, 4 locking device, 5 fixed sleeve, 6 differential tube, 7 force measuring device, 8 thermal-protective installation

The micrometer is a metrology tool that uses the operating principle of the screw pair to transfer the rotational movement into a linear

movement. Its main usage is to measure different kinds of outside dimensions.

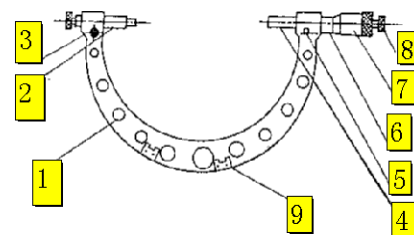


Figure 2 Micrometer with changeable or controllable gauge button

Where, 1 frame, 2 gauge button, 3 fastening screw of gauge button, 4 micrometer bolt, 5 locking device, 6 fixed sleeve, 7 differential tube, 8 force measuring device, 9 thermal-protective installation

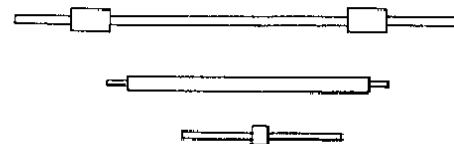


Figure 3 Measuring rod for checking

2. Subject and Condition of Calibration

2.1 Subject and Main Tools of Calibration

The items and the main tools for the calibration of micrometers are listed in Table 1.

2.2 Calibration Conditions

Before the calibration the micrometer must

be kept in room for temperature equilibrium and by the time of the calibration the room temperature must meet the requirements in Table 2.

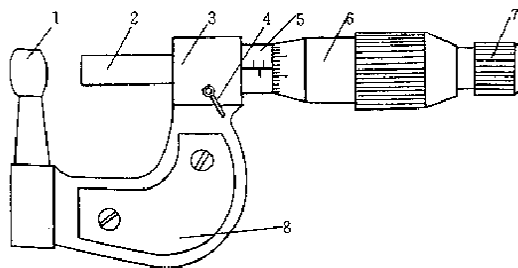


Figure 4 □-type micrometer for wall thickness measuring

Where, 1 frame, 2 gauge button (spherical measuring cap shown in Figure), 3 micrometer bolt, 4 locking device, 5 fixed sleeve, 6 differential tube, 7 force measuring device, 8 thermal-protective installation

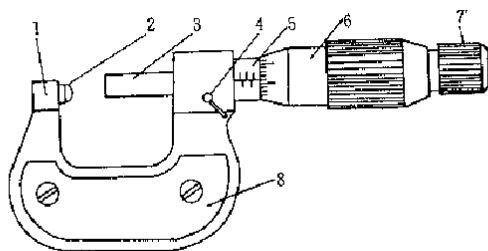


Figure 5 □-type micrometer for wall thickness measuring

Where, 1 gauge button, 2 micrometer bolt, 3 frame, 4 locking device, 5 fixed sleeve, 6 differential tube, 7 force measuring device,

8 thermal-protective installation

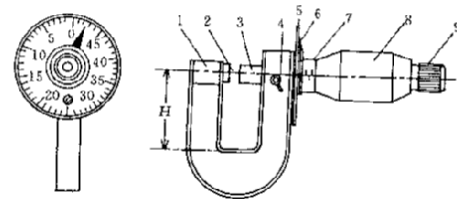


Figure 6 Micrometer for plate thickness measuring with dial

Where, 1 frame, 2 gauge button, 3 micrometer bolt, 4 locking device, 5 dial, 6 point hand, 7 fixed sleeve, 8 differential tube, 9 force measuring device

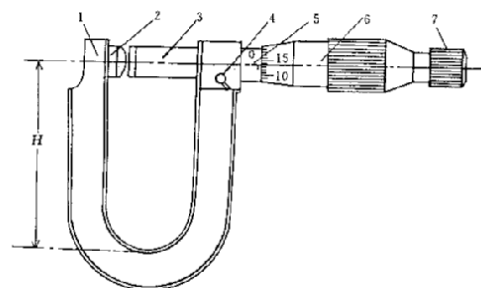


Figure 7 Micrometer for plate thickness measuring

Where, 1 frame, 2 gauge button, 3 micrometer bolt, 4 locking device, 5 fixed sleeve, 6 differential tube, 7 force measuring device


	ITTC – Recommended Procedures	7.6-02-04 Page 4 of 12	
	Sample Work Instructions Calibration of Micrometers	Effective Date 2002	Revision 00

Table 1

No	Items	Main calibration tools	Type of calibration		
			New product	In service	After repair
1	Exterior	-----	+	+	+
2	Relationship among parts	-----	+	+	+
3	Axial slide movement and radial sway of micrometer bolt	Level dial gauge with reading in 0.001mm	+	+	+
4	Relative deviation between gauge button and working plane of micrometer bolt	Levelling plane, level dial gauge or dial gauge with reading in 0.01mm	+	-	+
5	Measuring force	Force gauge for special use	+	+	+
6	Width and width difference of lines	Tool microscope	+	-	+
7	Relative position of point hand and dial	Plug gauge	+	+	+
8	Distance between end face edge of conical surface for differential tube and scratch plane of fixed sleeve	Tool microscope, plug gauge	+	-	+
9	Relative position between conical surface end face of differential tube and millimetre line of fixed sleeve	-----	+	+	+
10	Surface roughness of working plane	Sample block for comparison of surface roughness	+	-	+
11	Accuracy of working plane	Second class optical flat, first class tool edge ruler	+	+	+
12	Parallelism of two working planes	Parallel optical flat, fourth, fifth measuring blocks, steel ball trier	+	+	+
13	Error of indication	Fourth, fifth measuring blocks or relevant measuring block for special use	+	+	+
14	Measuring rod for checking	Optical metre, length measuring machine, fourth grade measuring block			

Note: “+” means calibration must be done; “-” means calibration may not be done


	ITTC – Recommended Procedures	7.6-02-04 Page 5 of 12	
	Sample Work Instructions Calibration of Micrometers	Effective Date 2002	Revision 00

Table 2

Measured range of calibrated micrometer (mm)	Allowed temperature deviation based on 20□ in room (□)		Time for temperature balance (h)
	Micrometer	Measuring rod for checking	
~100	±5	±3	2
> 100~500	±4	±2	3

3. Technical Requirements and Calibration Method

3.1 Exterior

3.1.1 Requirements:

3.1.1.1 The micrometer and the measuring rod should not have any mechanical damage, rust, any sign of being magnetized or any other fault. The graduation marks should be clear and well distributed.

3.1.1.2 The micrometer should have an attachment for the zero positioning. The micrometer with a range limit larger than 25 mm should have a measuring rod for checking its attachment.

3.1.1.3 The scale division value, the measuring range, the name or the mark of the manufacturer; and the serial number of production should be marked on the micrometer.

3.1.1.4 The micrometer and the measuring rod for checking in service and after repair should not have any exterior fault that affects its accuracy.

3.1.2 Calibration method: By eyesight.

3.2 Relationship Among Parts

3.2.1 Requirements

3.2.1.1 It should be possible for the differential tube and the micrometer bolt to be

steadily rotated and moved without the occurrence of seizure.

3.2.1.2 It should be possible for the controllable or the changeable gauge button to be smoothly adjusted, as well as assembled and disassembled. It should work reliably. The function of the locking device should be effective.

3.2.1.3 The indicator needle of a dial micrometer should be freely movable without sticking.

3.2.2 Calibration method: Tested and observed by eyesight.

3.3 Axial Slide Movement and Radial Sway of Micrometer Bolt

3.3.1 Requirement: Both the axial slide movement and the radial sway of micrometer bolt should not exceed 0.01 mm.

3.3.2 Calibration Method

3.3.2.1 The axial slide movement of the micrometer bolt can be calibrated by use of a level dial gauge with a reading of 0.001mm. During the calibration the level dial gauge should be kept touching the measuring surface of the micrometer bolt. A force of 3~5 N should be applied both in the forward and reverse direction of the axial bolt, as shown in Figure 8. The change of the indication of the level dial

gauge is exactly the value of the axial slide movement.

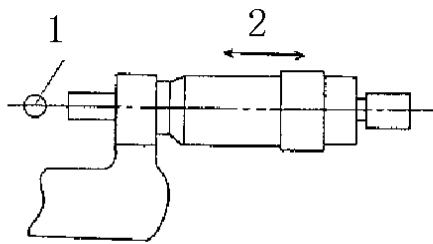


Figure 8

Where, 1 level dial gauge with reading in 0.001mm, 2 direction of exerted force

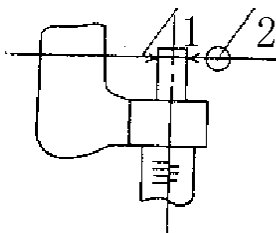


Figure 9

Where, 1 direction of exerted force, 2 level micrometer

3.3.2.2 The radial sway of the micrometer bolt can also be calibrated by use of a level dial gauge with a reading of 0.001 mm. During the calibration the micrometer bolt should be set 10 mm out of the frame. Then the level dial gauge should touch the end part of the bolt. A force of 2~3 N should be applied in the measuring direction of the level dial gauge and then in the reverse direction. The calibration should be carried out in two radial directions that are perpendicular to each other, as shown in Figure 9. The indicated change of the level dial gauge is the radial sway of the cali-

brated micrometer.

3.4 Relative Deviation Between Gauge Button and Working Plane of Micrometer Bolt

3.4.1 Requirement

The relative deviation between the gauge button and the working plane of the micrometer bolt should not exceed the regulation in Table 3.

Table 3..(mm)

Measured range	Relative deviation between gauge button and working plane of bolt
0~25	0.10
25~50	0.15
50~75	0.20
75~100	0.30
100~200	0.40
200~300	0.50
300~400	0.80
400~500	1.00

3.4.1 Calibration Method

The calibration should be carried out by use of a level dial gauge with the reading of 0.01 mm, on the levelling plane. Micrometers with a measuring range beyond 300 mm can be calibrated by use of a dial gauge with a reading of 0.01 mm. During the calibration the micrometer should be positioned on a levelling plane using jacks, as shown in Figure 10. The jacks may be adjusted till the micrometer bolt is parallel to the working surface of the levelling plane. The deviation x between the gauge button and the micrometer bolt in this direction can then be measured by the dial gauge. After that the frame of the cali-

brated micrometer should be turned 90° in the lateral direction. Then the deviation y in the other direction can be measured as above. The relative deviation between the gauge button and the working plane of the micrometer bolt Δ can be calculated by the following formula:

$$\Delta = \sqrt{x^2 + y^2}$$

This calibration can also be carried out by the use of other special instrumentation.

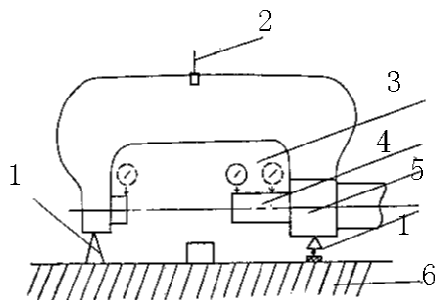


Figure 10

Where, 1 jacks, 2 carriage, 3 level dial gauge (or dial gauge) with reading in 0.01mm, 4 micrometer bolt, 5 calibrated micrometer, 6 levelling plane

3.5 Measuring Force

3.5.1 Requirement: The measuring force of the micrometer (that means the force exerted between the working planes and the spherical surface when touching each other) should be in the range of 6~10N.

3.5.2 Calibration Method: The calibration can be carried out by use of a special force gauge, with a scale division value not larger than 0.2N. During the calibration the

force should be measured when the working plane touches the spherical working surface of the force gauge.

3.6 Width and Width Difference of Lines

3.6.1 Requirements: The width of the longitudinal lines on the fixed sleeve and of the lines on the differential tube should be 0.15~0.20mm, The difference of their widths should not exceed 0.03 mm. The width of the lines on the dial should be 0.20~0.30 mm. The difference of their widths should not exceed 0.05mm.

3.6.2 Calibration method

The calibration can be performed by use of a tool microscope. At least three lines of the differential tube or of the dial should be selectively calibrated.

3.7 Relative Position of Indicator Needle and Dial

3.7.1 Requirements

The end of the indicator needle on the dial of the micrometer for the plate thickness measuring should cover 30~80% length of the short lines of the dial. The distance between the upper surface of the needle end edge and the surface of the dial should not exceed 0.7mm. The width of the needle end should coincide with the width of the lines on the dial. Their difference should not exceed 0.05mm.

3.7.2 Calibration Method: The relative positioning between the end of the indicator and the short lines on the dial can be estimated by eyesight. The distance between

the upper surface of the indicator end and the surface of the dial can be calibrated by use of a plug gauge. The above-mentioned calibration should be carried out at three well-distributed positions of the dial. The difference between the end of the indicator needle and the lines of the dial can be calibrated on a tool microscope.

3.8 Distance Between End Face Edge of Conical Surface For Differential Tube and Engraved Surface of Fixed Sleeve

3.8.1 Requirement: The distance between the end face edge of the conical surface for the differential tube and the engraved plane of the fixed sleeve should not exceed 0.4mm.

3.8.2 Calibration Method

It can be calibrated with a tool microscope or using the comparison method with a 0.4mm plug gauge positioned on the line surface of the fixed sleeve. The calibration should be carried out at least at three positions during one rotation of the differential tube.

3.9 Relative Position Between Conical Surface End Face of Differential Tube and Millimetre Line of Fixed Sleeve

3.9.1 Requirements

After the lower measuring limit has been adjusted correctly, when the zero line of the differential tube points the longitudinal line of the fixed sleeve, the end face of the differential tube should come into contact with the right edge of the millimetre line

on the fixed sleeve. If it does not come into contact, the line covering and the line separation must not exceed 0.05 mm and 0.1 mm respectively.

3.9.2 Calibration Method

After the lower measuring limit has been adjusted correctly and the end face of the differential tube has been adjusted till it contacts with the right side of any millimetre line on the fixed sleeve, the deviation can be read between the zero line of the differential tube and the longitudinal line of the fixed sleeve.

3.10 Surface Roughness of Working Plane

3.10.1 Requirements

The surface roughness R_a of the working planes of both of a micrometer for outer diameter measuring and the measuring rod used for checking, should not exceed 0.05 μ m.

The surface roughness R_a of the working plane of a micrometer for measuring wall and plate thickness, should not exceed 0.10 μ m.

3.10.2 Calibration method: It may be calibrated by using the method of comparison with a sample block, for the assessment of the surface roughness.

3.11 Accuracy of Working Plane

3.11.1 Requirements

The working plane accuracy of zero class micrometers, used for outer diameter measurements, should not exceed 0.6 μ m. Similarly for first class micrometers, used

for the outer diameter measurements, should not exceed 1 μ m. The working plane accuracy of the micrometer bolt of micrometers, used for wall thickness measurements, should not exceed 1.2 μ m. The working plane accuracy of micrometers, used for plate thickness measurements, should not exceed 1 μ m.

3.11.2 Calibration method

The calibration can be carried out by use of a second class optical flat on the basis of the optical interference method. The calibration of the micrometer in service can be carried out by use of a first class tool edge ruler on basis of the light test method. The working plane accuracy in the range of 0.2mm from the edge for the micrometer, with a working plane diameter of 6.5mm, cannot be taken into account. The working plane accuracy in the range of 0.5mm from the edge for the micrometer, with the working plane diameter of 8 mm, cannot be taken into account.

3.12. Parallelism of Two Working Planes

3.12.1 Requirements

The parallelism of the two working planes for the micrometer should not exceed the values in Table 4 when the locking device is fastened or loose.

The working plane parallelism of micrometers used for plate thickness measuring should not exceed 2 μ m.

Table 4

Measured range (mm)	Parallelism (μ m)	
	Zero class	First class
0~25	1.0	2.0
25~50	1.3	2.5
50~100	1.5	3.0
100~150	-----	4.0
150~200	-----	6.0
200~300	-----	7.0
300~400	-----	8.0
400~500	-----	10.0

3.12.2 Calibration Method

The parallelism of the two working planes of the micrometer, with the measuring limit up to 100mm, can be calibrated using a parallel optical flat or a measuring block. The parallelism of two working planes of zero-class micrometers can be calibrated using a fourth-grade-measuring block. The parallelism of the two working planes of first class micrometers for outer diameter measuring and for micrometers for plate thickness measuring can be calibrated by a fifth grade measuring block. The parallelism of the two working planes of micrometers, with a measuring range up to 100 mm, can be calibrated using a steel ball trier as shown in Figure 11.

When measuring blocks are used for the calibration, four groups of measuring blocks should be prepared with the mean dimensions of the upper and lower limits and with an interval of one quarter rotation of the differential tube.. The values can be read from the differential tube when each group of the measuring blocks is put on the four positions between the working planes shown in Figure 12. The difference between them can then be obtained. The maximum of readings of the four groups

can be taken as the parallelism of the two working planes of the calibrated micrometer

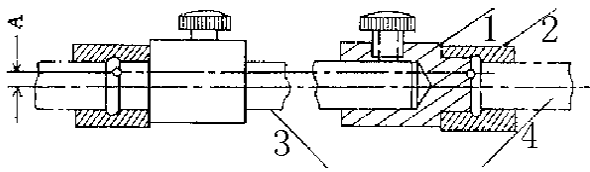


Figure 11

Where, 1 additional measuring cap for special use, 2 connecting sleeve, 3 measuring implement for alignment (or measuring rod for special use), 4 measuring rod of micrometer

Note: A is 3.5 mm, when diameter of measuring rod is $\phi 8\text{mm}$;

A is 3.0mm, when diameter of measuring rod is $\phi 6.5\text{mm}$.

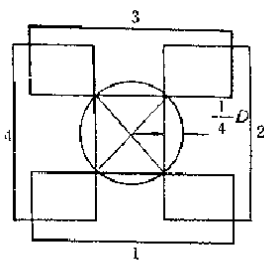


Figure 12

3.13 Error of Indication

Requirement: The indication error of micrometers for outer diameter measuring

should not exceed the limits in Table 5.

The indication error of the micrometers for plate and wall thickness measuring should not exceed $\pm 4\mu\text{m}$.

Table 5

Measured range	Indication error (μm)	
	Zero class	First class
0~100	± 2	± 4
100~150	-----	± 5
150~200	-----	± 6
200~300	-----	± 7
300~400	-----	± 8
400~500	-----	± 10

The parallelism of the two working planes can also be calibrated by use of other instrumentation with the relevant accuracy.

When a parallel optical flat is used for the calibration, four parallel optical flats with 0.25 pitch as thickness difference should be in turn located between the two working planes. The differential tube should be rotated till two working planes touch the parallel optical flats. Then the optical flat should be lightly rotated, until the number of interference lines on two working planes are reduced to the minimum. The number of interference lines on both working planes should be read respectively. The calculated result from the sum of both numbers and the wavelength of the light used, can be taken as the parallelism of the two working planes. Each of the optical flats should be used for the calibration according to the above-mentioned procedure. The maximum parallelism value of the measurements can be taken as the parallelism calibration result for the two working planes of the calibrated micrometer.

3.13.2 Calibration Method

Zero class micrometers for outer diameter measuring can be calibrated by use of fourth grade measuring blocks or relevant grade measuring blocks for special use. First class micrometers for outer diameter measuring and micrometers for plate and wall thickness measuring can be calibrated using fifth grade measuring blocks or

relevant grade measuring blocks. The calibrated points of the various micrometers should be well distributed upon five positions in the measuring range, as shown in Table 6. The indication errors of all the positions should not exceed the values in Table 5

Table 6 (mm)

Measured range	Size of calibrated points				
0~10	2.12	4.25	6.37	8.50	10.00
0~15	3.12	6.24	9.37	12.50	15.00
0~25	5.12	10.25	15.37	20.50	25.00
	or 5.12	10.24	15.36	21.50	25.00
>25	$A+5.12$	$A+10.25$	$A+15.37$	$A+20.50$	$A+25.00$
	or $A+5.12$	$A+10.24$	$A+15.36$	$A+21.50$	$A+25.00$

Note: where A is the down measuring limit of the micrometer

For micrometers for outer diameter measuring with a measuring range of above 150mm, only the indication error of the micrometer head may be calibrated. This calibration can be carried out by fifth grade measuring blocks or relevant grade measuring blocks for special use by the help of a special trier with the relevant accuracy according to the calibrated points of micrometers with a measuring range of 0~25mm, as shown in Figure 13.

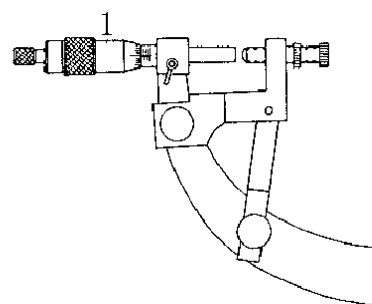


Figure 13

Where, 1 micrometer head

3.14 Measuring Rod for Checking

3.14.1 Requirements

The dimensional deviation and the parallelism of two working planes for the measuring rod should not exceed the values in Table 7.

3.14.2 Calibration Method

The dimension and the parallelism of the working planes for the measuring rod can be calibrated by using a fourth grade

measuring block on the basis of the comparison method, when the rod is located in an optical meter or in an length measuring machine. For rods with flat working planes the calibration can be carried out by use of a spherical measuring cap at five positions as shown in Figure 14. The size deviation of every position should not exceed the limits in Table 7. The difference of the maximum and the minimum values among five positions is the parallelism of the two working planes of the rod.

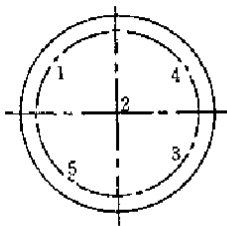


Figure 14

For rods with a spherical working surface, calibration can be carried out by use of a flat measuring cap having a diameter of 8mm.

Table 7

Nominal dimension	Size deviation (μm)		Parallelism of working
	Zero class	First class	
25	±1.0	±2.0	1.0
50	±1.5	±2.0	1.0
75	±1.5	±2.0	1.5
100~125	-----	±2.5	2.0
150~175	-----	±3.0	2.5
200~225	-----	±3.5	3.5
250~275	-----	±3.5	3.5
325~375	-----	±4.0	4.0
425~475	-----	±5.0	5.0

4. Treatment of Calibration Result and Calibration Period

4.1 Treatment of Calibration Results

For micrometers that meet the requirements of this working instruction, a calibration report will be supplied; For the ones which do not meet the requirement, a notice of the calibration result will be supplied.

4.2 Calibration Period

The calibration period can be determined upon the service condition.